
Installation instructions


Instruction Sheet



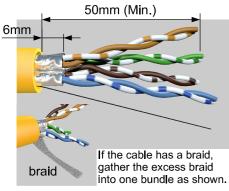


Step 1: Strip at least 50mm of jacket off of the cable.


Pull back the braid, and retain 6mm of foil from the cable end.

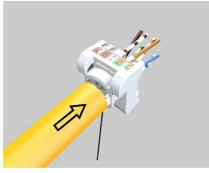

Step 2: Put wires through wire management and arrange in accordance with wiring color code (T568A/B).

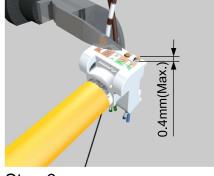

Step 3: Trim excess wires. The tips of the wires should protrude no more than 0.4mm.

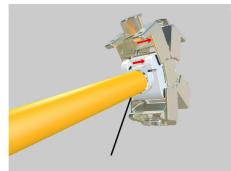

Step 4: Put the wire management on the IDC tower.

and cap should face the same direction.




Step 5:


Close the covers all the way, which will terminate the wires NOTE: The arrows on coupler to the IDC's. Then wrap the drain wire (or bundled braid) around the strain relief.



Step 6: Tighten a cable tie around the strain relief to complete the assembly for one side.

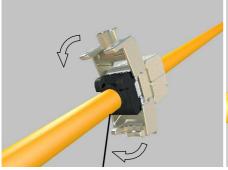

Step 7: Repeat steps 1~6 to the other side to complete the termination.

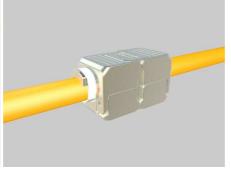

The finished termination.

eurolan.com info@eurolan.se